

SERVICE REPORT

Heritage Aged Care - Twin Parks Reservoir

33 Blake Street
Reservoir
Victoria 3073

Report Number R-00306

Reference

Service Date: 15th April 2024

Scope of Works

02 - Fire Sprinkler System - Wet Pipe (2012): Monthly (2)

0	Critical Defects	A defect that renders a system inoperative.
2	Non-critical Defects	A system impairment not likely to critically affect the operation of the system.
11	Non-conformances	Missing information or incorrect feature that does not affect the system operation.
2	Recommendations	A modification suggested to improve the system performance.
3	Informational Notes	Detailed advice or general comment.

Servicing Summary

Service	Asset	Quantity
02 - Fire Sprinkler System - Wet Pipe (2012): Monthly	02 - Fire Sprinkler System - Wet Pipe	3

Maintenance

02 - Fire Sprinkler System - Wet Pipe (2012): Monthly

AS1851-2012 (a1) - Routine service of fire protection systems and equipment

Asset	Status
004 - Fire Sprinkler System Sprinkler Valve	Spinkler booster East Blake st FAIL

Asset	Status
Non-conformance ID: 775 ↗ Description: Booster connection requires storz cap Resolution: Technician to investigate cause of issue and rectify where possible (excluding parts) Location: East blake st  Click photos to enlarge	Added: 15th Apr 2024 2:28PM Last Verified: 15th Apr 2024 2:30PM
Non-conformance ID: 774 ↗ Description: Signage not clear Resolution: Technician to investigate cause of issue and rectify where possible (excluding parts) Location: East blake st  Click photos to enlarge	Added: 15th Apr 2024 2:28PM Last Verified: 15th Apr 2024 2:30PM
W.1 - Fire Sprinkler System Residential Sprinkler System	West courtyard FAIL
Non-critical defect ID: 741 ↗ Description: West: Street valve is full of debris and requires cleaning. Resolution: Quotation required for rectification	Added: 5th Apr 2024 1:19PM
Non-conformance ID: 738 ↗ Description: West: 5-yearly testing due Resolution:	Added: 5th Apr 2024 12:45PM

Asset	Status
Non-conformance ID: 737 ↗	Added: 5th Apr 2024 12:44PM
Description: West: Spare sprinkler head required	
Resolution: Quotation required for rectification	
Non-conformance ID: 736 ↗	Added: 5th Apr 2024 12:44PM
Description: West: Spare spanner required	
Resolution: Quotation required for rectification	
Recommendation ID: 744 ↗	Added: 5th Apr 2024 1:43PM
Description: West: Sprinkler require 5 yearly head test	
Resolution:	
Recommendation ID: 739 ↗	Added: 5th Apr 2024 1:07PM
Description: West: Kitchen no protection in kitchen hood	
Resolution:	
Informational ID: 743 ↗	Added: 5th Apr 2024 1:42PM
Description: West: Nurses' Station - 2 new sprinkler heads required.	
Resolution: Quotation required for rectification	

**001 - Fire Sprinkler System Residential
Sprinkler System**

East - Outside left of main entrance

FAIL

Non-critical defect ID: 740 ↗	Added: 5th Apr 2024 1:12PM
Description: East: Unable to locate the incoming Main Street valve	
Resolution: .	

Asset	Status
Non-conformance ID: 735 ↗	Added: 5th Apr 2024 12:38PM
Description: East: 5-yearly testing due Resolution:	
Non-conformance ID: 734 ↗	Added: 5th Apr 2024 12:33PM
Description: East: Spare spanner required Resolution: Quotation required for rectification	
Non-conformance ID: 733 ↗	Added: 5th Apr 2024 12:33PM
Description: East: Spare sprinkler head required Resolution: Quotation required for rectification	
Informational ID: 745 ↗	Added: 5th Apr 2024 1:45PM
Description: East: Main reception needs one head deleted as they're too close Resolution: Quotation required for rectification	
Informational ID: 742 ↗	Added: 5th Apr 2024 1:27PM
Description: East: Nurses' Station - 2 new sprinkler heads required Resolution: Quotation required for rectification	

Repairs

001 - Fire Sprinkler System Residential Sprinkler System

FAIL

East - Outside left of main entrance

RESOLVED

Non-conformance

Added: 15th Apr 2024 2:15PM

ID: 771

Last Verified: 15th Apr 2024 2:17PM

Description:

Sprinkler booster
Signage not clear

Location:

East blake st



Click photos to enlarge

Parts/Labour

Quantity

003 - Fire Sprinkler System Sprinkler Valve

FAIL

Sprinkler booster West blake street

ADDED

Non-conformance

Added: 15th Apr 2024 2:28PM

ID: 773

Last Verified: 15th Apr 2024 2:30PM

Description:

No storz cap

Location:

West blake street



Click photos to enlarge

Parts/Labour

Quantity

ADDED Non-conformance

ID: 772 [↗](#)

Added: 15th Apr 2024 2:28PM

Last Verified: 15th Apr 2024 2:30PM

Description:

Signage non existent

Location:

West blake street



Click photos to enlarge

Parts/Labour

Quantity

Signoff

Maintenance has been carried out in accordance with Part 15 of the Victorian Building Regulations 2018.

Technician

Date/Time

Accreditations

Signature

Micra Fire
Technician

15th Apr 2024
12AM

Mike Alford

15th Apr 2024
12AM

Company Accreditations: